










Date: Wednesday, 11/21/2007 12:44:45 PM
 User: Kim Johnston

Process Sheet

3

Customer: CUL-DAR001 Dart Helicopters Services	Drawing Name: SKID TUBE ASSEMBLY
Job Number: 35907A	Part Number: D20563405 -041
Estimate Number: 12520	Drawing Number: D2580 REV D
P.O. Number:	Project Number: N/A
This Issue: 11/21/2007 S.O. No.:	Drawing Revision: D
Prsht Rev: NC	Material:
First Issue: 1/1 Type: LANDING GEAR	Due Date: 1/15/2008 Qty: 1 Um: Each
Previous Run: 35906A	
Written By: <u>7.11.21</u>	
Checked & Approved By: <u>7.11.21</u>	
Comment: Rev: C Revised Steps 06-09-06 JLM Rev: D Added SS Wearplates & Gaskets 07-07-09 JLM	
Additional Product	
Job Number: 	
Seq. #: 1.0	Machine Or Operation: DC
Description: DOCUMENT CONTROL	
	
	
Comment: DOCUMENT CONTROL Photocopy D205-634 bluefile & type labels per PPP D205-634-035 CHG002 N/A 7-11-27	
2.0	D25001190
Ext'n - 1" Beam Tube 4"	
	
	
Comment: Qty.: 1.0400 Each(s)/Unit Total: 1.0400 Each(s)	
Pick:	
Qty	Part Number Description Batch
1	D2500-1-190 Skid Tube Extrusion 34129 SL 7-11-27
3.0	D2596
205 Web	
	
	
Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)	
Pick:	
Qty	Part Number Description Batch
1	D2596 205 Web 35996 SL 7-11-27
4.0	LANDING GEAR 1
LANDING GEAR RESOURCE 1	
	
	
Comment: LANDING GEAR RESOURCE 1	
1- Inspect mat'l D2500-1-190 for damage	
2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends	
3-Drill pilot holes using drill jig DT 8149	
4-Acid etch and Alodine tube per QSI 005 4.1	

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 11/21/2007 12:44:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35907A

Part Number: D205634045 -041

Job Number:



Seq. #:

Machine Or Operation:

Description:

5-Open holes to 0.500" as per Dwg D2580 without cutting fluid

6-Countersink holes as per Dwg D2580 without cutting fluid

7-Deburr and blow out all chips from inside of tube

8-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting
Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 105489

Sikaflex expire date: 6-7-1

Start Time: 2:00 Date: 7-11-27

Fin Time: 4:00 Date: 7-11-28

SL 7-11-27

5.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

EL/SK 7-11-28

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

BE 07/12/12

N/A 2-Drill extra fwd hole as per DEO 9183 using
drill jig DT8461

N/A 3-Drill extra middle hole as per DEO 9183 using
drill jig DT8462

4-Drill pilot holes for aft cap using DT8215. ***DO NOT OPEN TO FINISH SIZE***

BE 07/12/12

N/A 5-Drill extra aft holes as per DEO 9183 using
drill jig DT8463 locating from aft cap hole and aft saddle hole.

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP


 

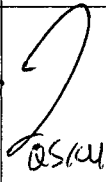
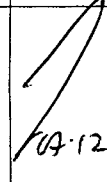
07/12/12

P70

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
07-12-07	5.0	Aft end cut too short. See NCR 271 R.C: Human error		- Lubricate 6061-T6 RB plug 0.0050 x 1ST. M <u>105071</u> Qty <u>42</u> - plug 0.009183 holes and weld per Q31004 M <u>106035</u> AIR - grind flush.	 07-12-12	 07-12-12	 07-12-12	 07-12-07

NOTE: Date & initial all entries

Date: Wednesday, 11/21/2007 12:44:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35907A

Part Number: D205634045 -041

Job Number:



Seq. #:

Machine Or Operation:

Description :

8.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2576-3

Step

*B23464 **

BE 07-12-12

9.0

D2579

Crossbolt Spacer



Comment: Qty.: 24.0000 Each(s)/Unit Total : 24.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

20

D2579

Spacers

*B34789 **

BE 07/12/12

10.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 Step Remove alodine as required.

BE 07/12/12

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

m 106035

BE 07/12/12

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004. For D2579

spacers, weld one

side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

m 106035

BE 07/12/12

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

7-12-19

5-Drill holes for wearplates using DT 8217 Open holes to 19/64", adjust stopper not to hit web. Deburr

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

*****DO NOT COUNTERBORE EXTRA HOLES PUT IN AT STEP 13, 14 AND 15 (LEAVE AT

0.564" AS PER DEO 9183)*****

7-Open aft cap holes to #6 Drill bit. Deburr

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Deburr

SL 7-12-19

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 11/21/2007 12:44:46 PM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35907A

Part Number: D205634045 -041

Job Number:



Seq. #:

Machine Or Operation:

Description:

11.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

FD 07-12-20 ①

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

FD 12/21 ①

13.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FD/a.m 07/12/27 ①

14.0

POWDER COATING

POWDER COATING

Powder coat white per QSI005
4.3.5.1

Comment: POWDER COATING

Powder Coat ****GREEN****Sandtex (Ref: 4.3.5.8) as per QSI 005 4.3

a.m 07-12-27 ①

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FD 07/12/27 ①

16.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch: B.34349

a.m 07.12.27 ①

17.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: m100188

a.m 07.12.27 ①

18.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: n 104374

a.m 07.12.27 ①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Wednesday, 11/21/2007 12:44:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35907A

Part Number: D205634045 -041

Job Number:



Seq. #:

Machine Or Operation:

Description:

19.0

ALS71032130

Insert



ALS 41032130 mi 2008/1/14



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

Insert

Batch: m105729

a.m 07.12.27

0

20.0

AN3C4A

BOLT



Comment: Qty.: 50.0000 Each(s)/Unit Total: 50.0000 Each(s)

BOLT

Batch: m106431

a.m 07.12.27

0

21.0

D356613

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B32744

a.m 07.12.27

0

22.0

D35665

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

GASKET

Batch: B335788

B34354

a.m 07.12.27

0

23.0

D35661

GASKET



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

GASKET

Batch: B335788

a.m 07.12.27

0

24.0

D356413

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch: B33454

a.m 07.12.27

0

25.0

D356411

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARSHOE

Batch: B34805

a.m 07.12.27

0

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
07/12/27	20.1	AN960 C10L 50 x Batch: M106575 M106574 in 2008/1/14						

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 11/21/2007 12:44:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35907A

Part Number: D20563405 -041

Job Number:



Seq. #:

Machine Or Operation:

Description :

26.0

D35649

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 334807

A.M 07.12.27 ①

27.0

D35645

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: 336111

A.M 07.12.27 ①

28.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: 327168

A.M 07.12.27 ①

29.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: 333450

A.M 07.12.27 ①

30.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291 M105585

Sikaflex expire date: 08-07

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M105585

Sikaflex expire date: 08-07

A.M 07.12.27 ①

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

M106332

A.M 08.01.02

Batch:

①

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Wednesday, 11/21/2007 12:44:46 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 35907A

Part Number: D205634045-041

Job Number:



Seq. #:

Machine Or Operation:

Description :

31.0

QC5

INSPECT WORK TO CURRENT STEP



08/01/02 @



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

32.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-045-041

Location:

PPP Rev: H

8/01/02 SP



33.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



2008/1/4

W

35907A

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries



DESIGN #	DRAWN BY RH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07.06.28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:


- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF NO. TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
35907A


Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DETAIL A
SCALE 5:24

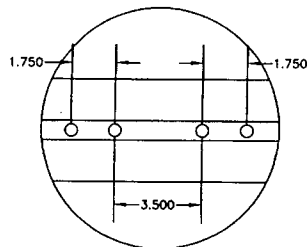


DETAIL B
SCALE 5:24

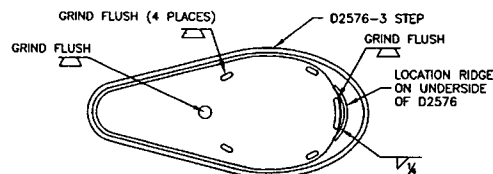


RELEASED
07-08-18

DETAIL C
SCALE 5:24

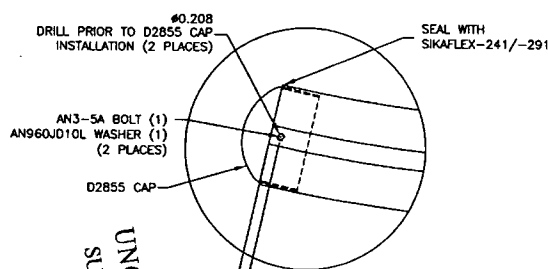


SECTION D-D
SCALE 5:24

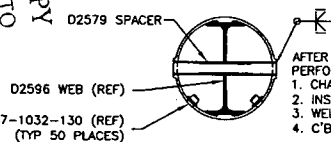


AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP


D2580-1 DRILLING DETAIL

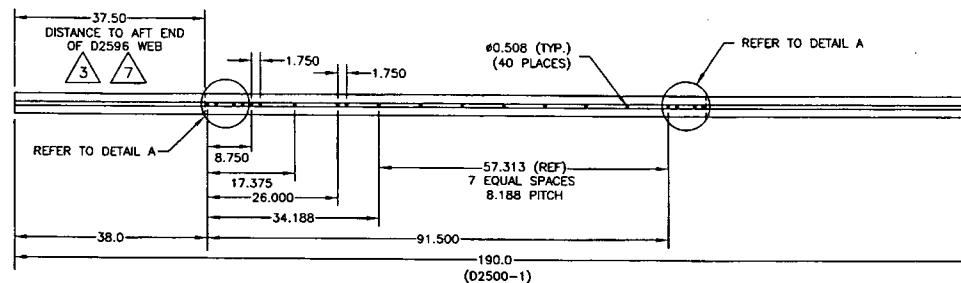

D2580-1 BENDING AND CUTTING DETAIL

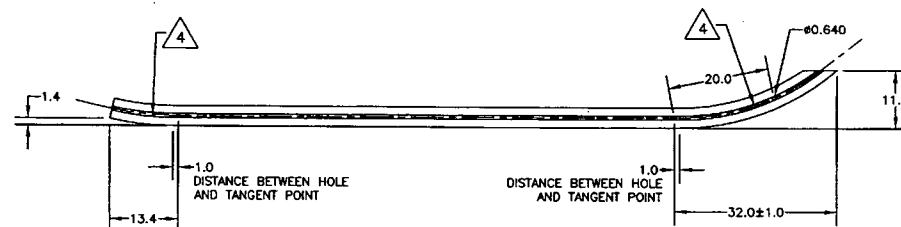

D2580-041 ASSEMBLY DETAIL

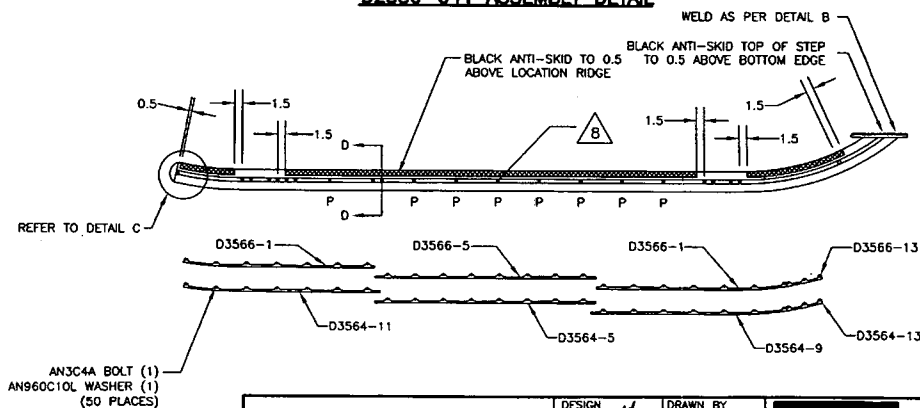

D2580-041 NOTES


- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

COPYRIGHT © 1988 BY DART AEROSPACE LTD.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	DRAWN BY	DART	DART AEROSPACE LTD. HARWESBURY, ONTARIO, CANADA
CHECKED	APPROVED	DRAWING NO.	REV. D
DATE		D2580	SHEET 2 OF 3
		TITLE	SCALE
		205 SKIDTUBE ASSEMBLY	1:24

DETAIL E
SCALE 5:24

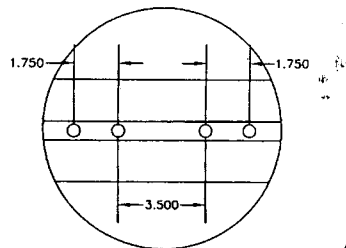


DETAIL F
SCALE 5:24

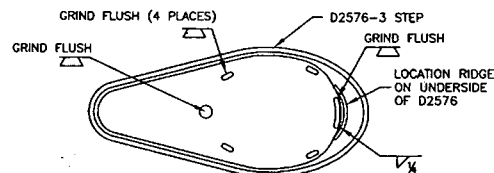


RELEASED
07-18-18

DETAIL G
SCALE 5:24

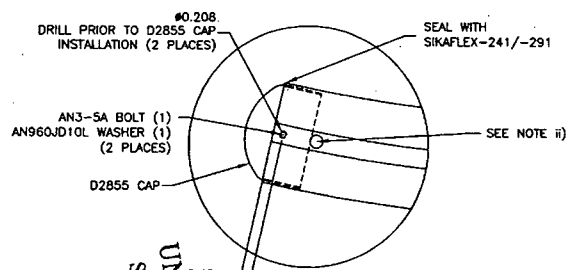


SECTION H-H
SCALE 5:24

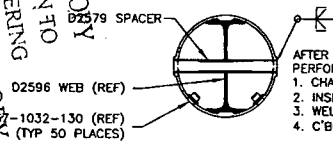


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP


D2580-1 DRILLING DETAIL

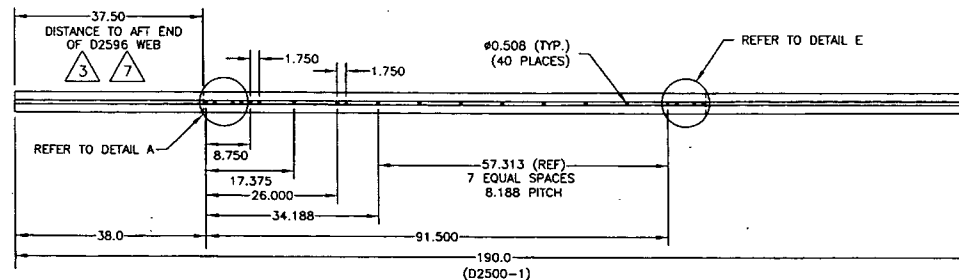

D2580-5 BENDING AND CUTTING DETAIL
(MAKE FROM D2580-1 DRILLING DETAIL)

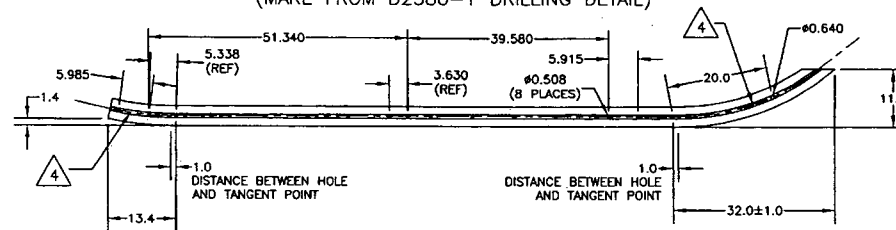

D2580-045 ASSEMBLY DETAIL

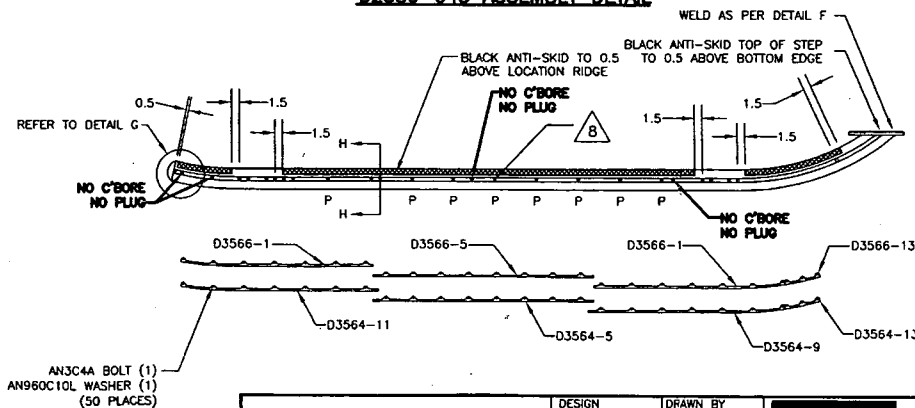

D2580-045 NOTES

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

COPYRIGHT © 1998 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN <i>RH</i>	DRAWN BY <i>RH</i>	DART	DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA
CHECKED <i>H</i>	APPROVED <i>H</i>	DRAWING NO. D2580	REV. D SHEET 3 OF 3
DATE 07.02.27	TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24	

NO. 133

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliot
Joint Welding Procedure ti
Part number and Job number D205 634 011 / B35642

TEST WELDS REQUIRED

BASE METAL Aluminium WELDING PROCESS ti
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skid tube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07-11-27

Qualifier P. J. D.

Date: Wednesday, 11/21/2007 12:44:27 PM
 User: Kim Johnston

Process Sheet

3

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 205 SKID INSTALLATION KIT
 Job Number : 35907
 Estimate Number : 12519
 P.O. Number :
 This Issue : 11/21/2007 S.O. No. :
 Prsht Rev. : NC
 First Issue : / / Type : LANDING GEAR
 Previous Run : 35906
 Part Number : D205634015 041
 Drawing Number : IIN D205-634 REV D
 Project Number : N/A
 Drawing Revision : D
 Material :
 Due Date : 1/15/2008 Qty: 1 Um: Each
 Written By :
 Checked & Approved By :
 Comment : Est Rev: A New Issue 00-04-04 EC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC

DOCUMENT CONTROL



Comment: Photocopy bluefile & type labels per PPP205-634-015 041 CHG 004 002

2.0 35907A

SKID TUBE ASSEMBLY



Comment: Sub-Component SKID TUBE ASSEMBLY

3.0 K10003

D205-634-011 Saddle Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
 D205-634-011 Saddle Kit

4.0 QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

5.0 PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1
 Identify and pack for shipping as per PPP D205-634-015
 Location: _____
 PPP Rev: _____

REFERENCE ONLY

6.0 QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion

